

# Manhole Inspection Summary

Manhole # S05SS\_016MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05SS** Node: **016** Status: **Found**

Insp Date: **2/28/08 3:22 PM**

Incomplete Comments

Crew: **TJ JK SD KR**  
Inspector: **Johnson**  
Firm: **URS**

**Location** Address: **4038 FAIRFAX RD**

Cross Street: **OAKFIELD AVE**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **72** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ Loose Brick ☒ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☒ Leaks ☒ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **4** Missing: **0** ☐ Corroded

**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View




Top View



CHIMNEY/GRADE ADJUSTMENT




Defect 3

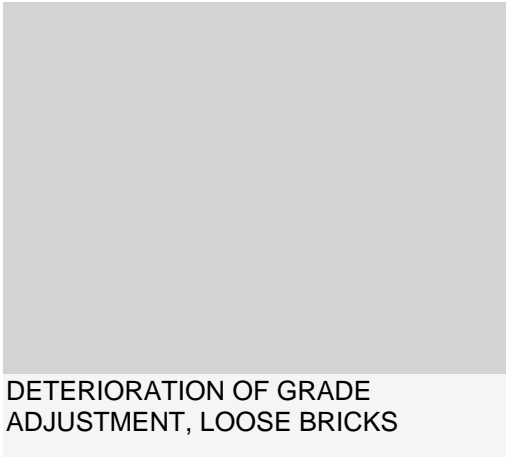


DETERIORATION OF GRADE  
ADJUSTMENT, LOOSE BRICKS

Defect 2

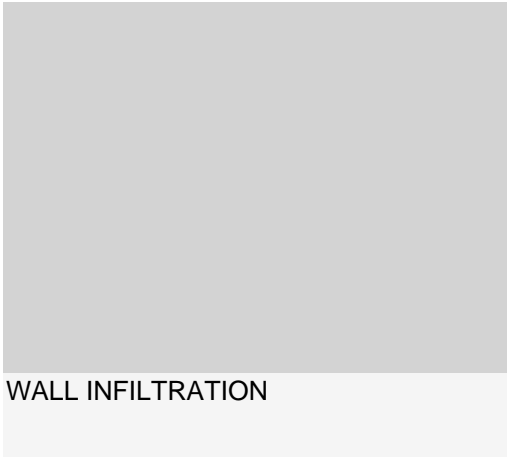

WALL INFILTRATION

Defect 1

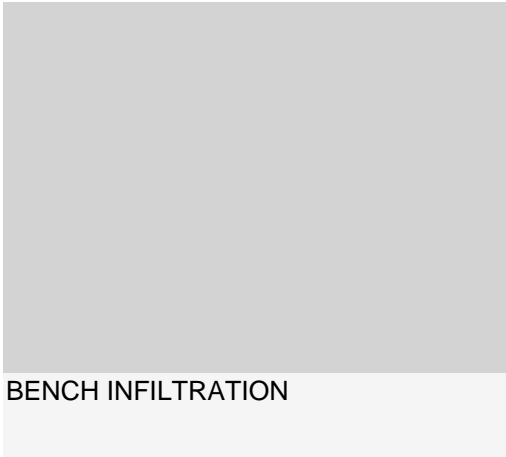

BENCH INFILTRATION

## Manhole Inspection Summary

Manhole # S05SS\_016MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



CHANNEL DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **12.28** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'Clock



BENCH DEBRIS, DETERIORATED BARREL

Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **9.40** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **10.26** (ft.)  
Inv Depth: **11.26** (ft.)  
Drop Condition: **Open**

Connects To: **Dead End**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S05SS\_016MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.92** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **11.06** (ft.)

Inv Depth: **12.06** (ft.)

Drop Condition: **Open**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.18** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection